

VersaEdge Extra Tall Stair Nose

Technical Information — Sizes

VersaEdge Extra Tall

The VersaEdge Stair Nose combines style and function to enhance the beauty of a staircase or step. For use on flooring with an overall thickness of up to 19 mm (0.75").


Surface Material: High Wear Resistant Aluminum Oxide Laminate

Core Material: Aluminum

VT-VEX Shim

To be used with VersaEdge for floors for flush installations (See illustrations at bottom right).

Material: Standard MDF/HDF

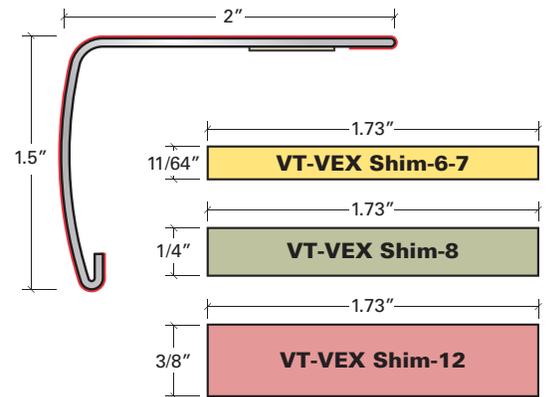


Installation

Overlap Install

Locked Down Install


Used where floating of the floor is not required, as with Stair Tread or Glued-Down/Nailed-Down floors. This can be used on floating floors where expansion and contraction will occur on the opposite side of the flooring plane.

Laminate/Engineered Wood Vinyl/LVT

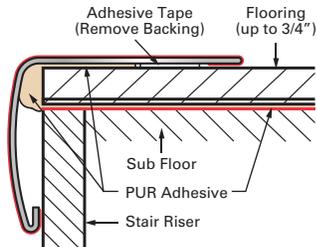


Floating Install

Vinyl/LVT

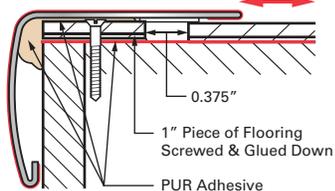

Laminate/Engineered Wood

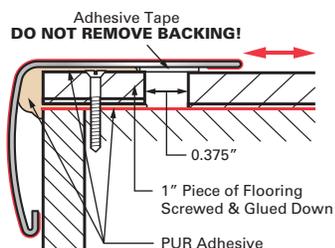


Flush Install

Locked Down Install


Used where floating of the floor is not required, as with Stair Tread or Glued-Down/Nailed-Down floors. This can be used on floating floors where expansion and contraction will occur on the opposite side of the flooring plane.

Tongue side of plank MUST face the VersaEdge. VersaEdge, Shims, and flooring planks must be glued down to subfloor.


Flooring with an overall thickness of 2-3 mm

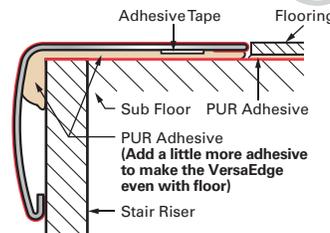


Flooring with an overall thickness of 4 mm

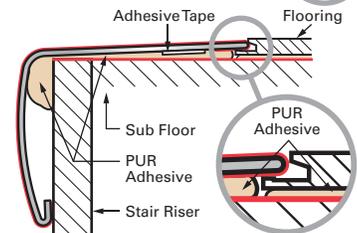


Flooring with an overall thickness of 6-7 mm

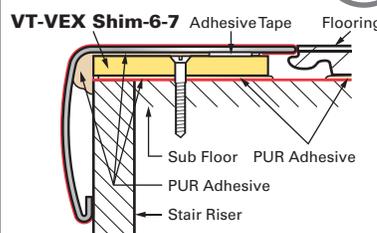

Flooring with an overall thickness of 8 mm

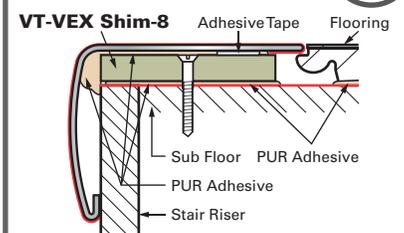


Flooring with an overall thickness of 12 mm

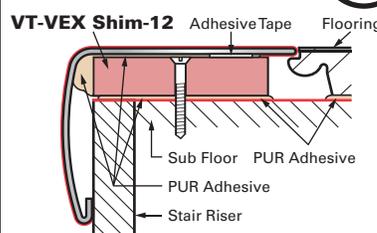

"LOCK-DOWN" INSTALLATION

Flooring with an overall thickness of up to 19 mm (0.75")

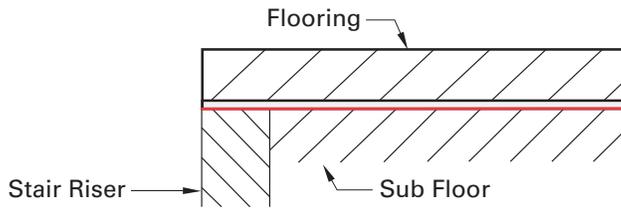



Step 1

Install the riser flush to the stair. Clean flooring and molding as directed below:

CLEANING PREPARATION FOR BOTH SURFACES

Preparing the floor & molding as outlined is mandatory to achieve the required bonding strength

1. Use a damp cloth (water only) to clean both surfaces of loose particles or surface films.
2. Roughen the surfaces with sandpaper (100-150 grit), sanding sponge or metal brush. For flooring, only roughen up area that will be covered (1.25" to 1.5").
3. Degrease both surfaces to remove all traces of oil, grease, dust, and fingerprints by using a solvent such as methyl ethyl ketone (MEK), acetone or isopropyl alcohol.
4. Let both surfaces dry thoroughly before applying PUR adhesive.

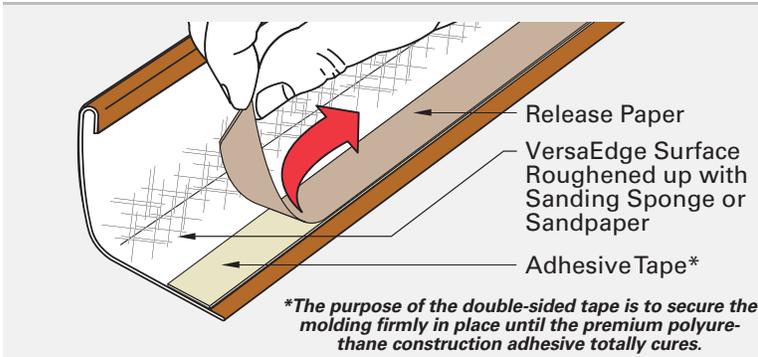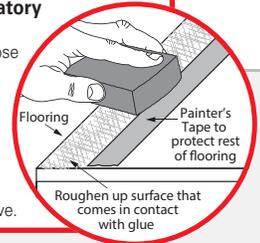


Step 2

Turn VersaEdge over and roughen the inside surface of the VersaEdge to increase bond by means of 60 grit sandpaper, sanding sponge, or a metal brush. Then, gently peel the release paper all the way off the adhesive tape.

Step 3


Next, apply a generous bead of a **Premium Polyurethane Construction Adhesive** along the entire inside corner. **Be sure to overlap the tape with the PUR adhesive.**

Underside of molding generously covered with PUR adhesive

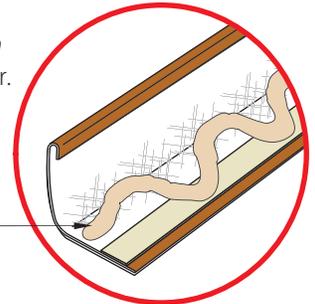


Step 4

Touch the bottom of molding to the stair riser and carefully roll the stair nose in place. Make any final adjustments before you push the molding all the way down. Once it's in the final position, press down firmly with your hands and make your way down the entire stair nose. It may take 2 or 3 passes to set it firmly in place.

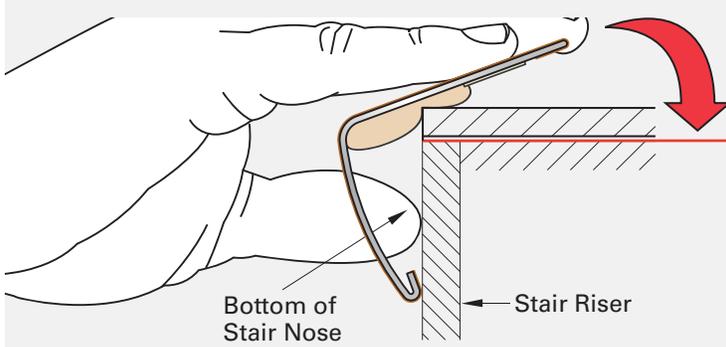

Step 5

Let the PUR adhesive cure for at least 4 hours before any walking on it. For exposure to full traffic, wait 24 to 48 hours.

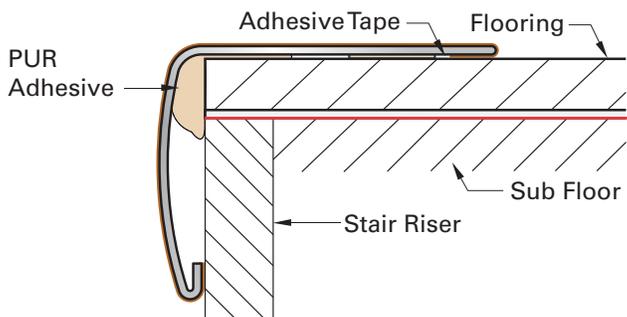


NOTE: Complete cure takes 48 hours.

VersaEdge Extra Tall Stair Nose

Installation on flooring with an overall thickness of up to 19 mm (0.75").

"FLOATING" INSTALLATION

Flooring with an overall thickness of up to 19 mm (0.75")

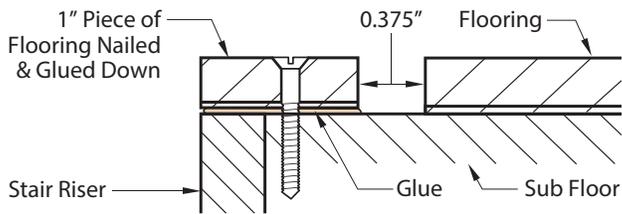



Step 1

Install the riser flush to the stair. Cut a 1" wide strip of your floor. Drill, counter-sink, screw and glue it flush to the stair riser. Install flooring 0.375" from the glued down 1" strip. **DO NOT glue flooring down.** Clean flooring and molding as directed below:

CLEANING PREPARATION FOR BOTH SURFACES

Preparing the floor & molding as outlined is mandatory to achieve the required bonding strength


1. Use a damp cloth (water only) to clean both surfaces of loose particles or surface films.
2. Roughen the surfaces with sandpaper (100-150 grit), sanding sponge or metal brush. For flooring, only roughen up area that will be covered (1.25" to 1.5").
3. Degrease both surfaces to remove all traces of oil, grease, dust, and fingerprints by using a solvent such as methyl ethyl ketone (MEK), acetone or isopropyl alcohol.
4. Let both surfaces dry thoroughly before applying PUR adhesive.

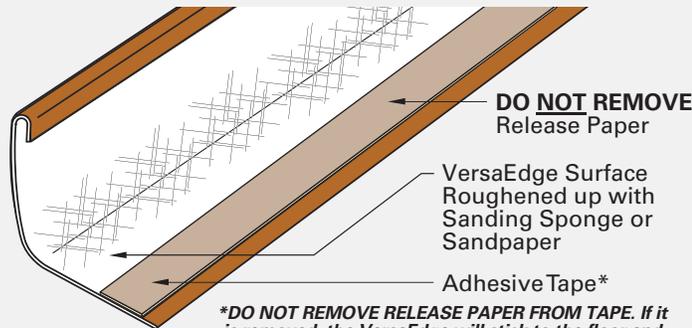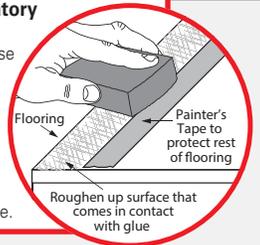

***DO NOT REMOVE RELEASE PAPER FROM TAPE. If it is removed, the VersaEdge will stick to the floor and keep it from floating.**

Step 2



Turn VersaEdge after following the cleaning preparation above. **DO NOT peel the release paper off the adhesive tape.**

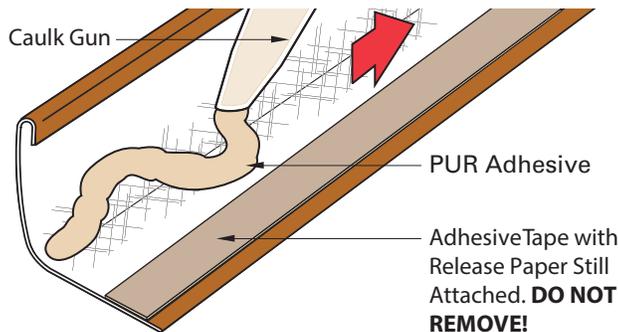

Step 3


Next, apply a generous bead of a **Premium Polyurethane Construction Adhesive** along the entire inside corner. **Be sure to NOT to overlap the tape with the PUR adhesive.**

Underside of molding generously covered with PUR adhesive

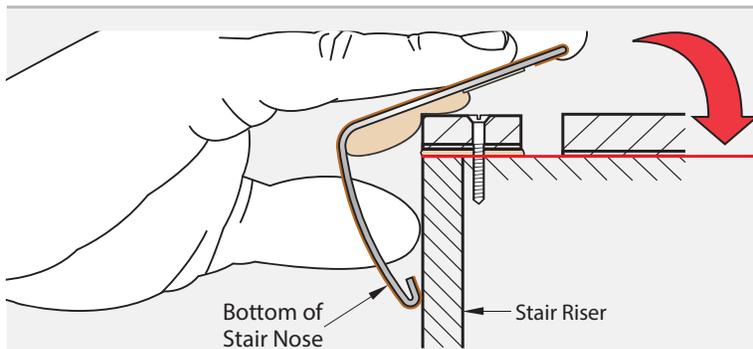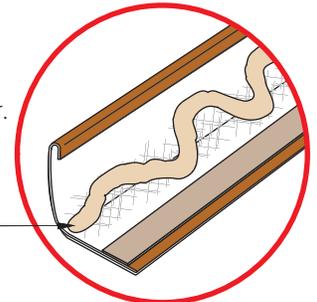

Step 4

Touch the bottom of molding to the stair riser and carefully roll the stair nose in place. Make any final adjustments before you push the molding all the way down. Once it's in the final position, press down firmly with your hands and make your way down the entire stair nose. It may take 2 or 3 passes to set it firmly in place.

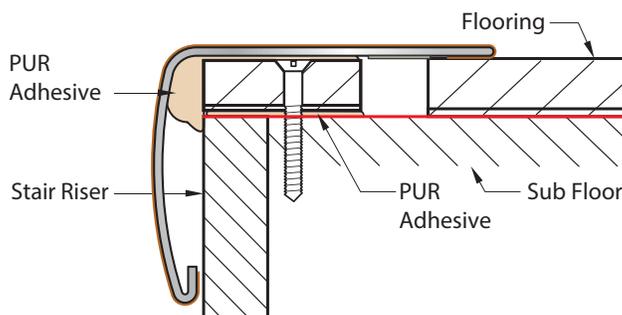

Step 5


Let the PUR adhesive cure for at least 4 hours before any walking on it. For exposure to full traffic, wait 24 to 48 hours.

NOTE: Complete cure takes 48 hours.

"Flush Lock-Down" Installation

Flooring with an overall thickness of

2 mm

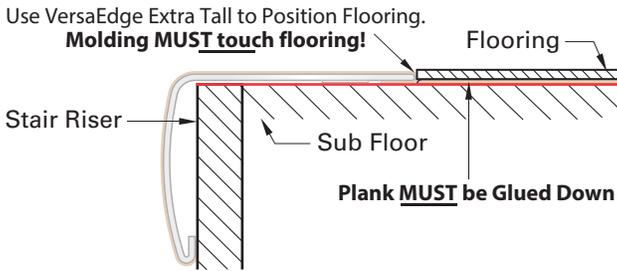



Step 1

Install the riser flush to the stair. Use VersaEdge to determine where to start your flooring. VersaEdge must fit snugly next to plank. Remove VersaEdge and **glue the flooring plank down**. Clean flooring and molding as directed below:

CLEANING PREPARATION FOR BOTH SURFACES


Preparing the floor & molding as outlined is mandatory to achieve the required bonding strength

1. Use a damp cloth (water only) to clean both surfaces of loose particles or surface films.
2. Roughen the surfaces with sandpaper (100-150 grit), sanding sponge or metal brush. For flooring, only roughen up area that will be covered (1.25" to 1.5").
3. Degrease both surfaces to remove all traces of oil, grease, dust, and fingerprints by using a solvent such as methyl ethyl ketone (MEK), acetone or isopropyl alcohol.
4. Let both surfaces dry thoroughly before applying PUR adhesive.

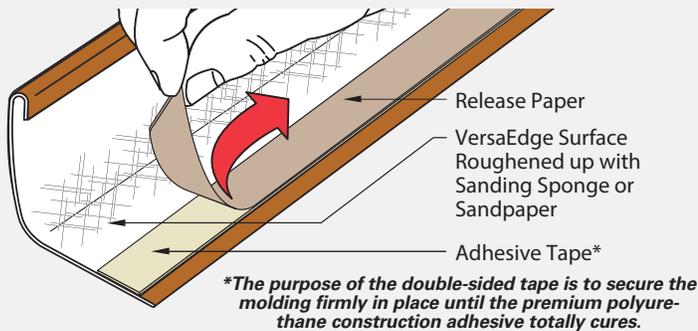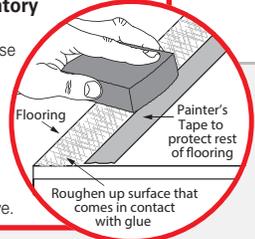

Step 2



Turn VersaEdge over and roughen the inside surface of the VersaEdge to increase bond by means of 60 grit sandpaper, sanding sponge, or a metal brush. Then, gently peel the release paper all the way off the adhesive tape.

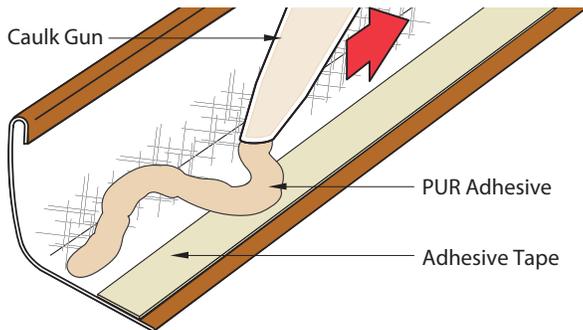

Step 3


Next, apply a generous bead of a **Premium Polyurethane Construction Adhesive** along the entire inside corner. **Be sure to overlap the tape with the PUR adhesive.**

Underside of molding generously covered with PUR adhesive

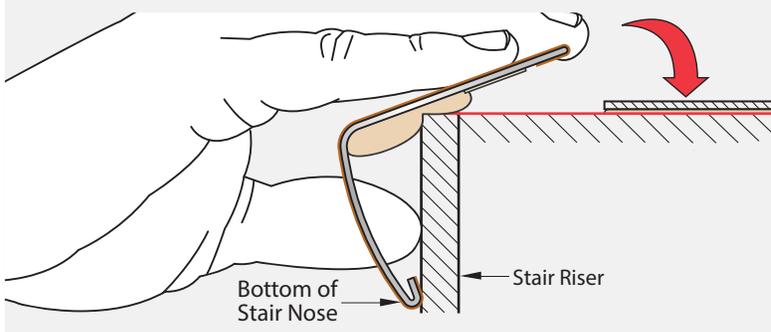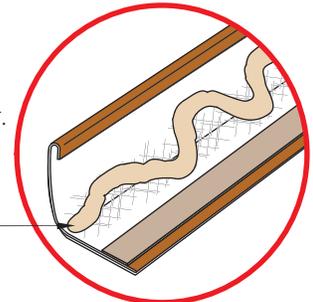

Step 4

Touch the bottom of molding to the stair riser and carefully roll the stair nose in place. Make any final adjustments before you push the molding all the way down. Once it's in the final position, press down firmly with your hands and make your way down the entire stair nose. It may take 2 or 3 passes to set it firmly in place.

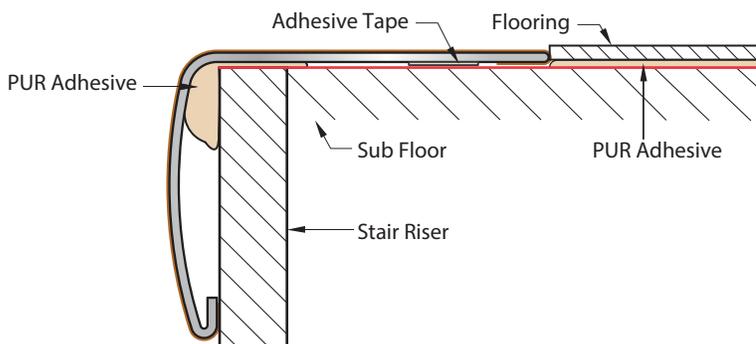

Step 5


The tape may not sufficiently adhere to the rougher stair or subfloor surfaces. **Allow at least 24 hours for the PUR adhesive to form a bond.** You should always start at top of stairs and work your way down to avoid contact with the installed moldings until cured.

NOTE: Complete cure takes 48-72 hours.

"Flush Lock-Down" Installation

Flooring with an overall thickness of

3 mm

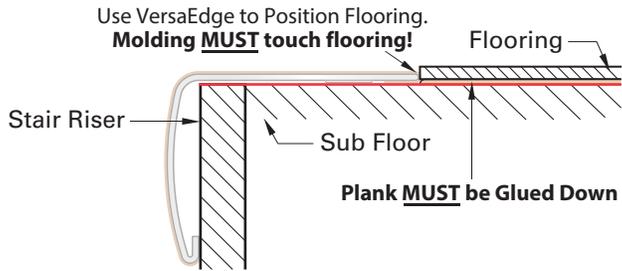



Step 1

Install the riser flush to the stair. Use VersaEdge to determine where to start your flooring. VersaEdge must fit snugly next to plank. Remove VersaEdge and **glue the flooring plank down**. Clean flooring and molding as directed below:

CLEANING PREPARATION FOR BOTH SURFACES


Preparing the floor & molding as outlined is mandatory to achieve the required bonding strength

1. Use a damp cloth (water only) to clean both surfaces of loose particles or surface films.
2. Roughen the surfaces with sandpaper (100-150 grit), sanding sponge or metal brush. For flooring, only roughen up area that will be covered (1.25" to 1.5").
3. Degrease both surfaces to remove all traces of oil, grease, dust, and fingerprints by using a solvent such as methyl ethyl ketone (MEK), acetone or isopropyl alcohol.
4. Let both surfaces dry thoroughly before applying PUR adhesive.

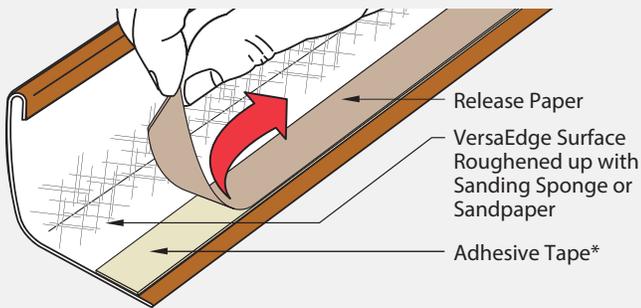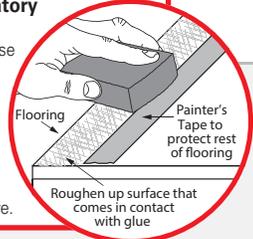

Step 2



Turn VersaEdge over and roughen the inside surface of the VersaEdge to increase bond by means of 60 grit sandpaper, sanding sponge, or a metal brush. Then, gently peel the release paper all the way off the adhesive tape.

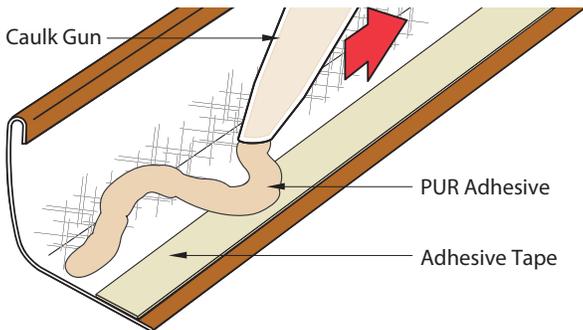

Step 3


Next, apply a generous bead of a **Premium Polyurethane Construction Adhesive** along the entire inside corner. **Be sure to overlap the tape with the PUR adhesive.** Reveal edge of plank may show when VersaEdge is installed. To compensate, apply a little more adhesive to the molding.

Underside of molding generously covered with adhesive

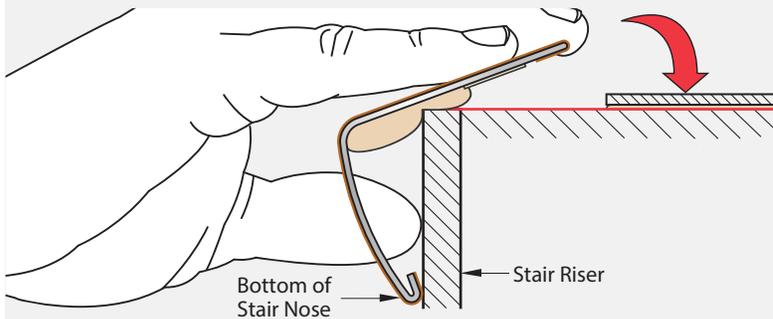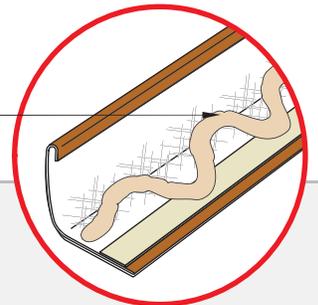

Step 4

Touch the bottom of molding to the stair riser and carefully roll the stair nose in place. Make any final adjustments before you push the molding all the way down. Once it's in the final position, press down firmly with your hands and make your way down the entire stair nose. It may take 2 or 3 passes to set it firmly in place.

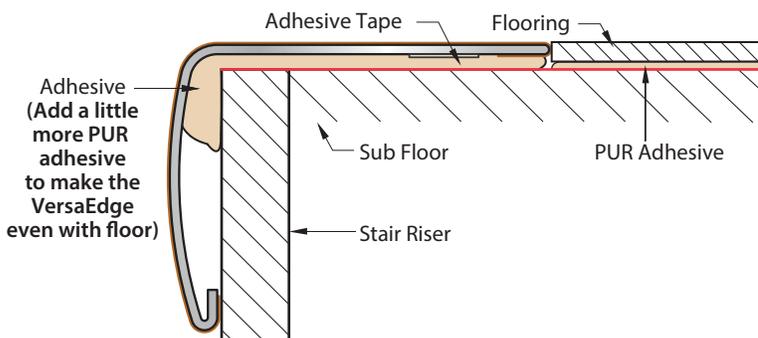

Step 5


The tape may not sufficiently adhere to the rougher stair or subfloor surfaces. **Allow at least 24 hours for the PUR adhesive to form a bond.** You should always start at top of stairs and work your way down to avoid contact with the installed moldings until cured.

NOTE: Complete cure takes 48-72 hours.

“Flush Lock-Down” Installation

Flooring with an overall thickness of

4
mm

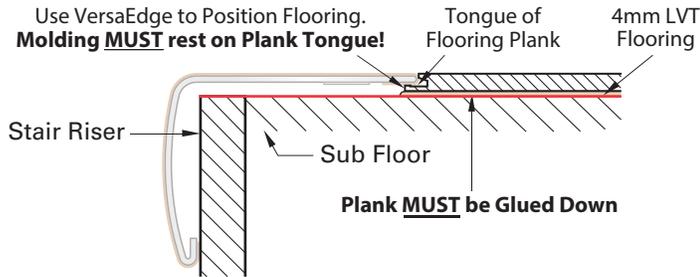


Step 1

Install the riser flush to the stair. Use VersaEdge to determine where to start your flooring. **Tongue side of flooring plank MUST face VersaEdge** so VersaEdge can fit snugly onto Tongue. Remove VersaEdge and **glue the flooring plank down**. Clean flooring and molding as directed below:

CLEANING PREPARATION FOR BOTH SURFACES


Preparing the floor & molding as outlined is mandatory to achieve the required bonding strength

1. Use a damp cloth (water only) to clean both surfaces of loose particles or surface films.
2. Roughen the surfaces with sandpaper (100-150 grit), sanding sponge or metal brush. For flooring, only roughen up area that will be covered (1.25" to 1.5").
3. Degrease both surfaces to remove all traces of oil, grease, dust, and fingerprints by using a solvent such as methyl ethyl ketone (MEK), acetone or isopropyl alcohol.
4. Let both surfaces dry thoroughly before applying PUR adhesive.

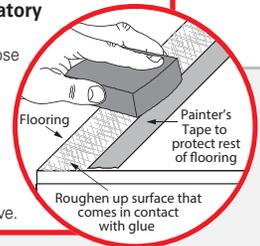

Step 2


Turn VersaEdge over and roughen the inside surface of the VersaEdge to increase bond by means of 60 grit sandpaper, sanding sponge, or a metal brush. Then, gently peel the release paper all the way off the adhesive tape.

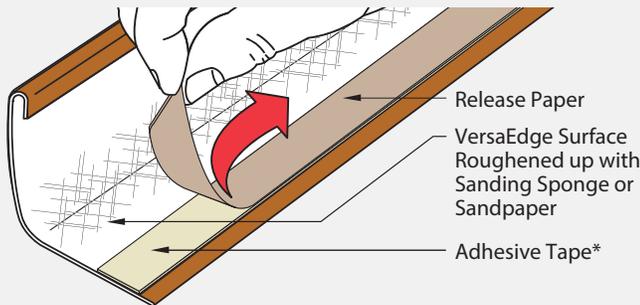

Step 3



Next, apply a generous bead of a **Premium Polyurethane Construction Adhesive** along the entire inside corner. **Be sure to overlap the tape with the PUR adhesive.** Reveal edge of plank may show when VersaEdge is installed. To compensate, apply a little more adhesive to the molding.

Underside of molding generously covered with PUR adhesive

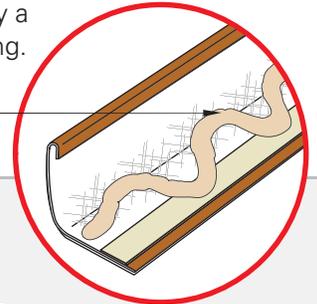


Step 4

Touch the bottom of molding to the stair riser and carefully roll the stair nose in place. Make any final adjustments before you push the molding all the way down. Once it's in the final position, press down firmly with your hands and make your way down the entire stair nose. It may take 2 or 3 passes to set it firmly in place.

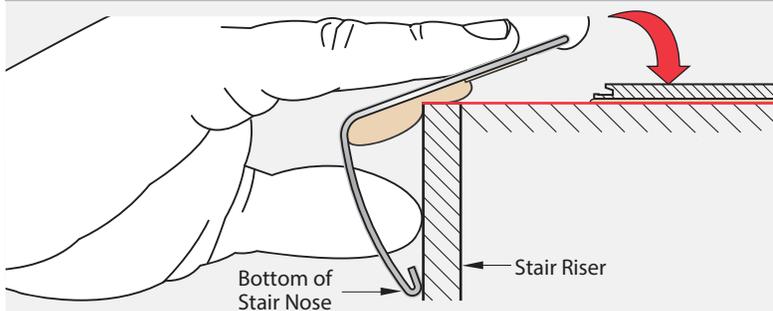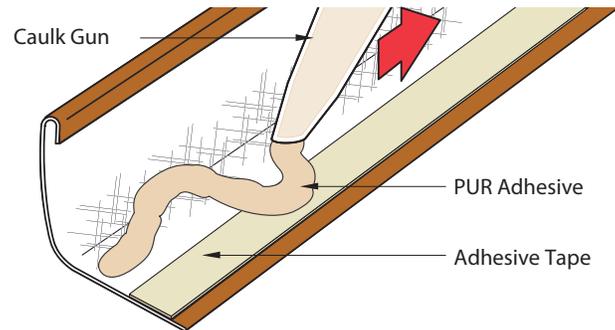

Step 5

The tape may not sufficiently adhere to the rougher stair or subfloor surfaces. **Allow at least 24 hours for the PUR adhesive to form a bond.** You should always start at top of stairs and work your way down to avoid contact with the installed moldings until cured.

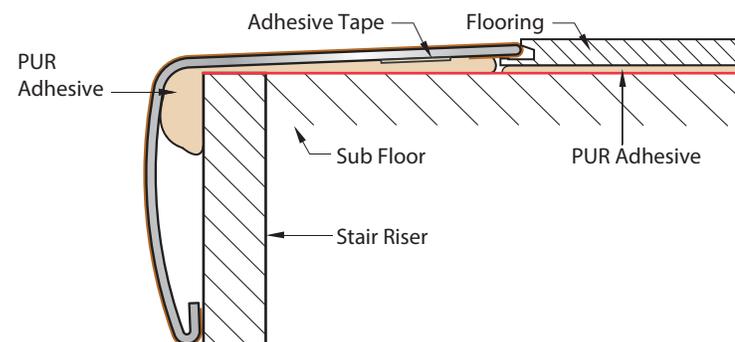


NOTE: Complete cure takes 48-72 hours.

“Flush Lock-Down” Installation

Flooring with an overall thickness of

6-7 mm

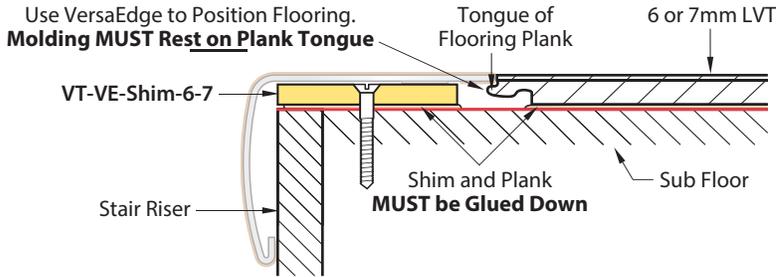


Step 1

Install the riser flush to the stair. Use VersaEdge and shim to determine where to start your flooring. **Tongue side of flooring plank MUST face VersaEdge** so VersaEdge can fit snugly onto Tongue. Remove VersaEdge and **glue the flooring plank and shim down**. Clean flooring and molding as directed below:

CLEANING PREPARATION FOR BOTH SURFACES


Preparing the floor & molding as outlined is mandatory to achieve the required bonding strength

1. Use a damp cloth (water only) to clean both surfaces of loose particles or surface films.
2. Roughen the surfaces with sandpaper (100-150 grit), sanding sponge or metal brush. For flooring, only roughen up area that will be covered (1.25" to 1.5").
3. Degrease both surfaces to remove all traces of oil, grease, dust, and fingerprints by using a solvent such as methyl ethyl ketone (MEK), acetone or isopropyl alcohol.
4. Let both surfaces dry thoroughly before applying PUR adhesive.

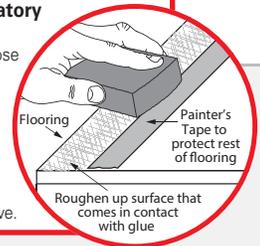

Step 2



Turn VersaEdge over and roughen the inside surface of the VersaEdge to increase bond by means of 60 grit sandpaper, sanding sponge, or a metal brush. Then, gently peel the release paper all the way off the adhesive tape.

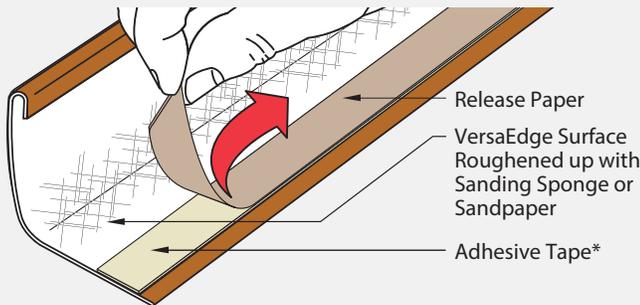

Step 3


Next, apply a generous bead of a **Premium Polyurethane Construction Adhesive** along the entire inside corner. **Be sure to overlap the tape with the PUR adhesive.** Reveal edge of plank may show when VersaEdge is installed. To compensate, apply a little more adhesive to the molding.

Underside of molding generously covered with PUR adhesive

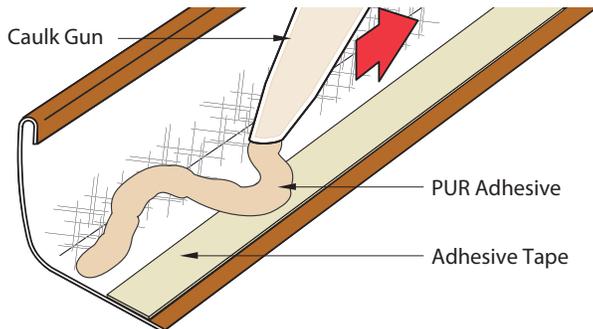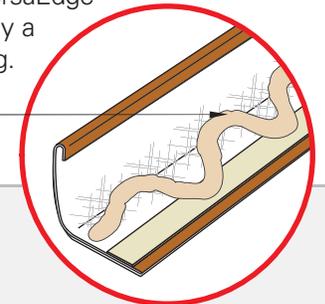


Step 4

Touch the bottom of molding to the stair riser and carefully roll the stair nose in place. Make any final adjustments before you push the molding all the way down. Once it's in the final position, press down firmly with your hands and make your way down the entire stair nose. It may take 2 or 3 passes to set it firmly in place.

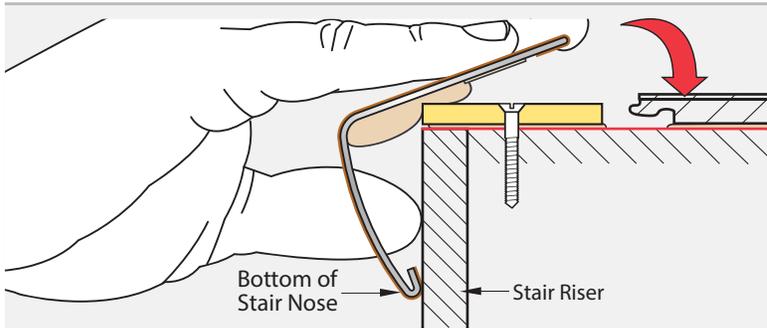

Step 5


The tape may not sufficiently adhere to the rougher stair or subfloor surfaces. **Allow at least 24 hours for the PUR adhesive to form a bond.** You should always start at top of stairs and work your way down to avoid contact with the installed moldings until cured.

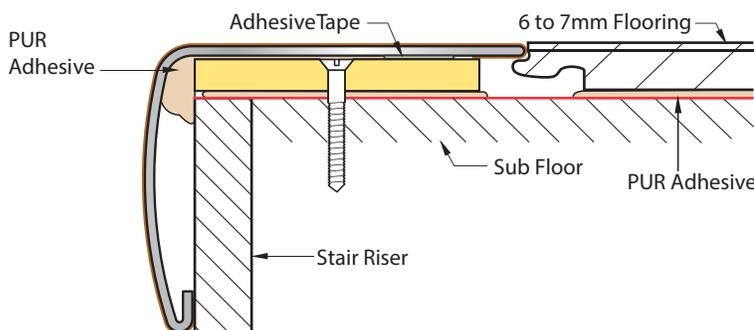

NOTE: Complete cure takes 48-72 hours.

"Flush Lock-Down" Installation

Flooring with an overall thickness of

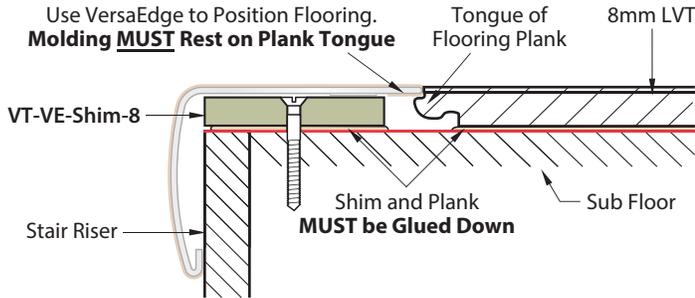



Step 1

Install the riser flush to the stair. Use VersaEdge and shim to determine where to start your flooring. **Tongue side of flooring plank MUST face VersaEdge** so VersaEdge can fit snugly onto Tongue. Remove VersaEdge and **glue the flooring plank and shim down**. Clean flooring and molding as directed below:

CLEANING PREPARATION FOR BOTH SURFACES


Preparing the floor & molding as outlined is mandatory to achieve the required bonding strength

1. Use a damp cloth (water only) to clean both surfaces of loose particles or surface films.
2. Roughen the surfaces with sandpaper (100-150 grit), sanding sponge or metal brush. For flooring, only roughen up area that will be covered (1.25" to 1.5").
3. Degrease both surfaces to remove all traces of oil, grease, dust, and fingerprints by using a solvent such as methyl ethyl ketone (MEK), acetone or isopropyl alcohol.
4. Let both surfaces dry thoroughly before applying PUR adhesive.

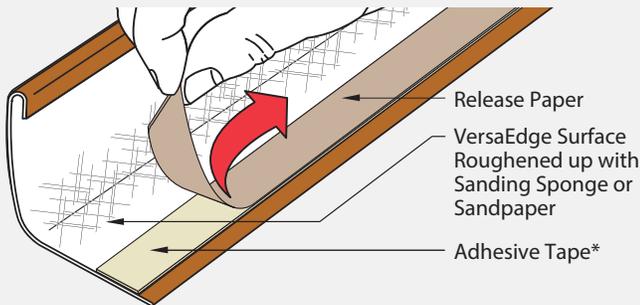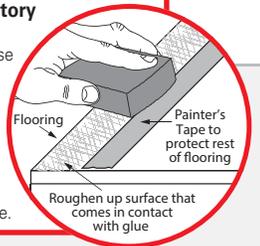

Step 2



Turn VersaEdge over and roughen the inside surface of the VersaEdge to increase bond by means of 60 grit sandpaper, sanding sponge, or a metal brush. Then, gently peel the release paper all the way off the adhesive tape.

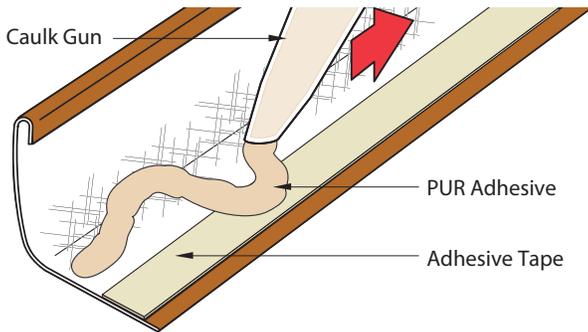

Step 3

Next, apply a generous bead of a **Premium Polyurethane Construction Adhesive** along the entire inside corner. **Be sure to overlap the tape with the PUR adhesive.** Reveal edge of plank may show when VersaEdge is installed. To compensate, apply a little more adhesive to the molding.

Underside of molding generously covered with PUR adhesive

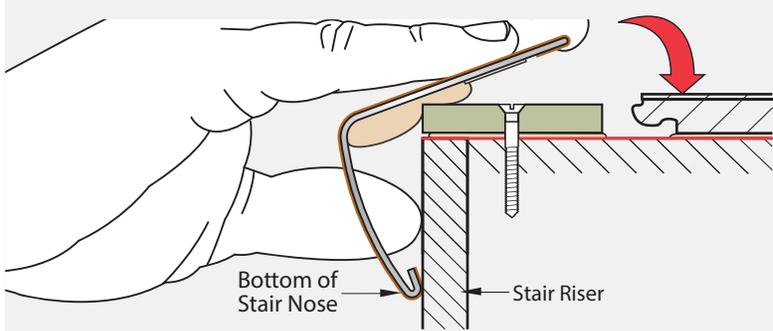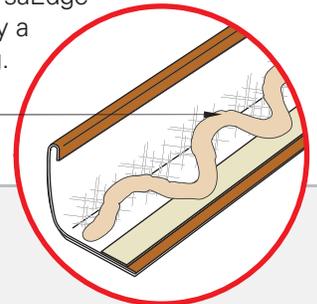


Step 4

Touch the bottom of molding to the stair riser and carefully roll the stair nose in place. Make any final adjustments before you push the molding all the way down. Once it's in the final position, press down firmly with your hands and make your way down the entire stair nose. It may take 2 or 3 passes to set it firmly in place.

Step 5

The tape may not sufficiently adhere to the rougher stair or subfloor surfaces. **Allow at least 24 hours for the PUR adhesive to form a bond.** You should always start at top of stairs and work your way down to avoid contact with the installed moldings until cured.

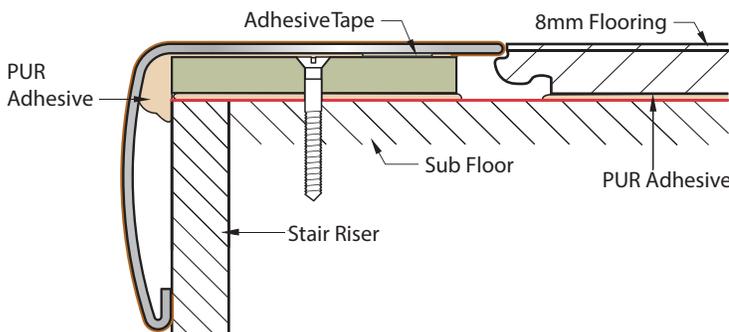


NOTE: Complete cure takes 48-72 hours.

“Flush Lock-Down” Installation

Flooring with an overall thickness of

12 mm

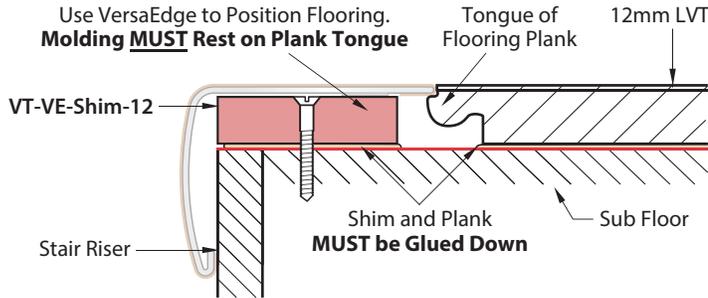


Step 1

Install the riser flush to the stair. Use VersaEdge and shim to determine where to start your flooring. **Tongue side of flooring plank MUST face VersaEdge** so VersaEdge can fit snugly onto Tongue. Remove VersaEdge and **glue the flooring plank and shim down**. Clean flooring and molding as directed below:

CLEANING PREPARATION FOR BOTH SURFACES


Preparing the floor & molding as outlined is mandatory to achieve the required bonding strength

1. Use a damp cloth (water only) to clean both surfaces of loose particles or surface films.
2. Roughen the surfaces with sandpaper (100-150 grit), sanding sponge or metal brush. For flooring, only roughen up area that will be covered (1.25" to 1.5").
3. Degrease both surfaces to remove all traces of oil, grease, dust, and fingerprints by using a solvent such as methyl ethyl ketone (MEK), acetone or isopropyl alcohol.
4. Let both surfaces dry thoroughly before applying PUR adhesive.

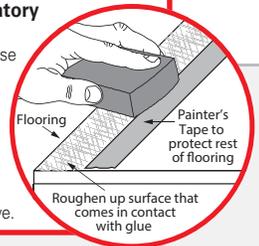

Step 2



Turn VersaEdge over and roughen the inside surface of the VersaEdge to increase bond by means of 60 grit sandpaper, sanding sponge, or a metal brush. Then, gently peel the release paper all the way off the adhesive tape.

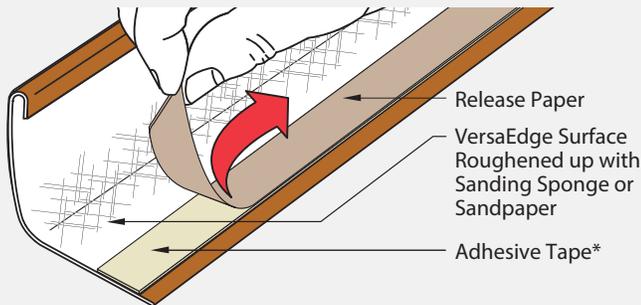

Step 3


Next, apply a generous bead of a **Premium Polyurethane Construction Adhesive** along the entire inside corner. **Be sure to overlap the tape with the PUR adhesive**. Reveal edge of plank may show when VersaEdge is installed. To compensate, apply a little more adhesive to the molding.

Underside of molding generously covered with PUR adhesive

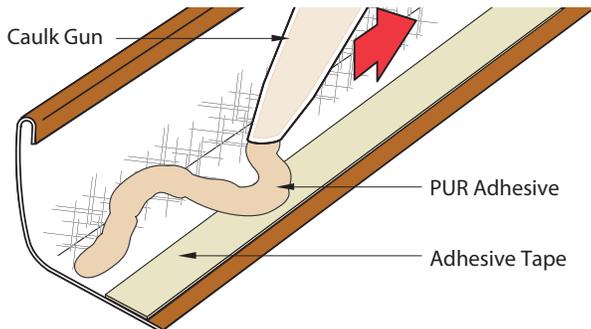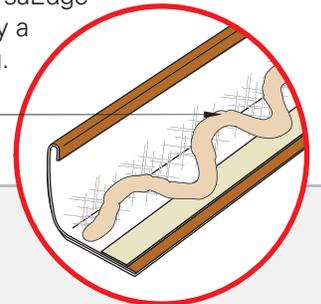


Step 4

Touch the bottom of molding to the stair riser and carefully roll the stair nose in place. Make any final adjustments before you push the molding all the way down. Once it's in the final position, press down firmly with your hands and make your way down the entire stair nose. It may take 2 or 3 passes to set it firmly in place.

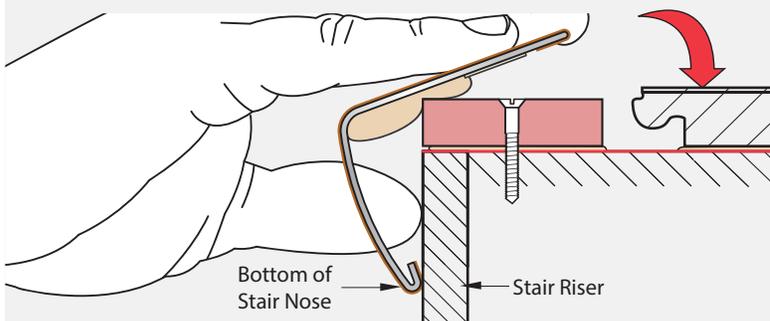

Step 5

The tape may not sufficiently adhere to the rougher stair or subfloor surfaces. **Allow at least 24 hours for the PUR adhesive to form a bond**. You should always start at top of stairs and work your way down to avoid contact with the installed moldings until cured.

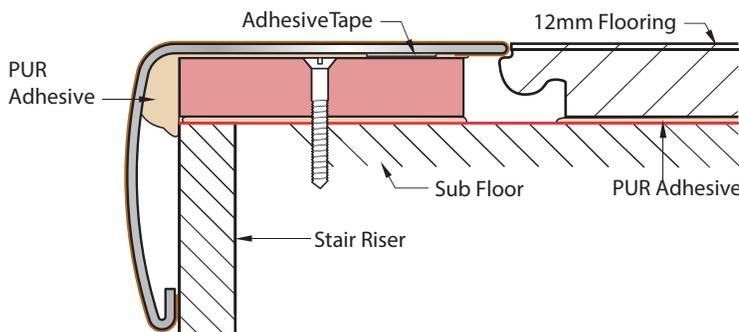

NOTE: Complete cure takes 48-72 hours.